

Range Icon

Low Battery Indication

Laser Active Indicator

Measurement History

Current Measurement

MEASURE

▶ Measure

▶ Selecting Units (press 2 sec)


POWER









▶ On (push 1.5 sec)

▶ Off (push 1.5 sec)


MEASURE

▶ Measure

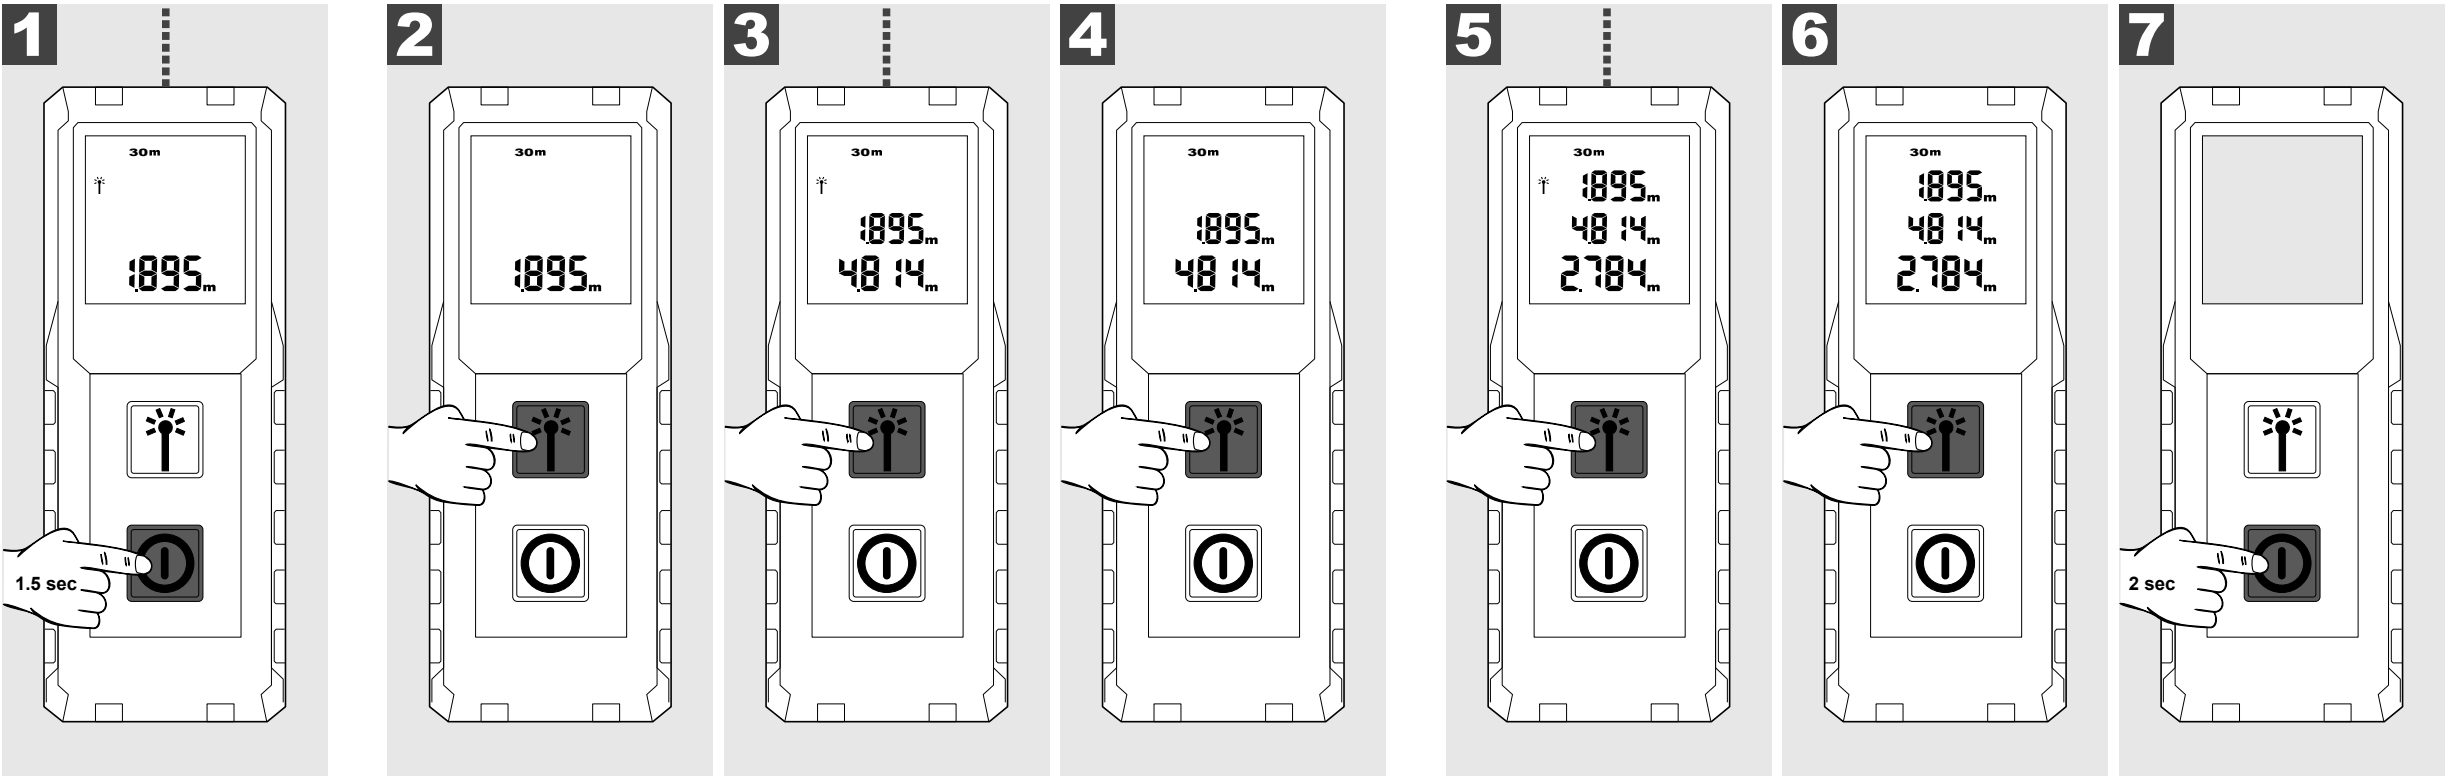

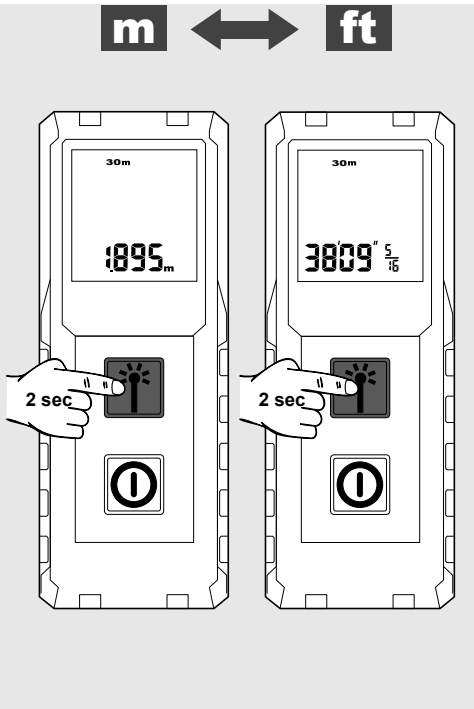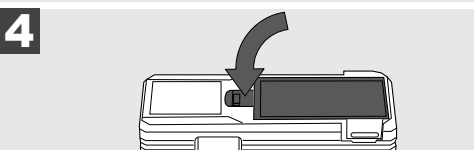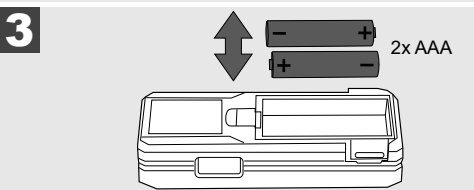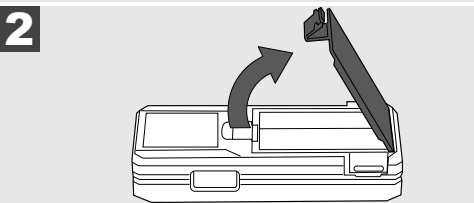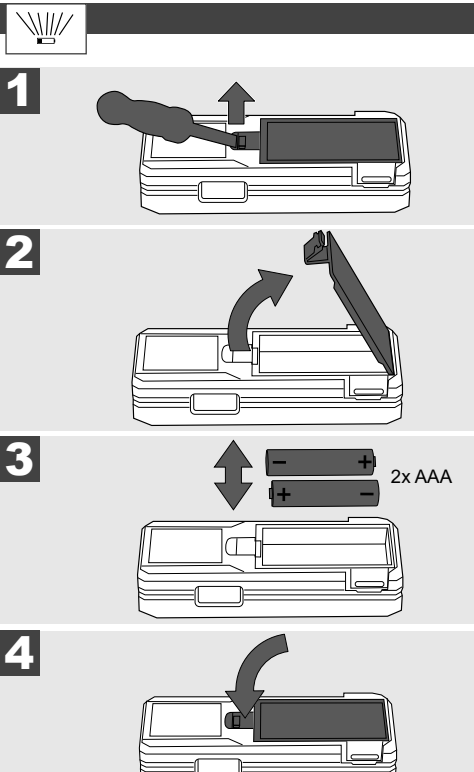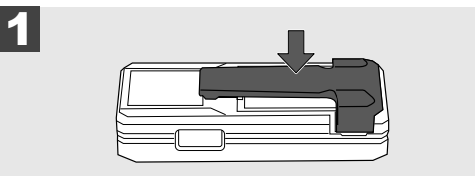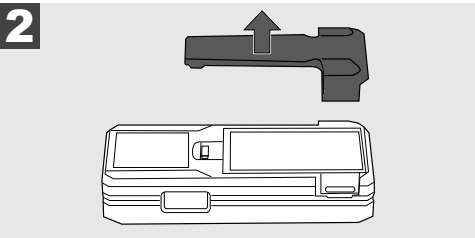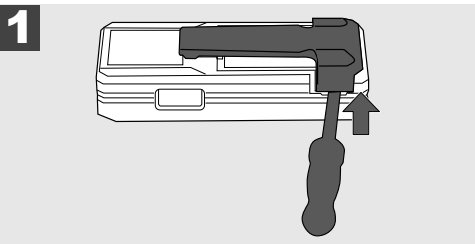

LDM 30 Quickstart Guide

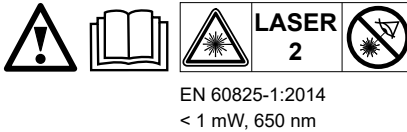

Copyright 2021
Techtronic Industries GmbH
Max-Eyth-Str. 10
71364 Winnenden
Germany
+49 (0) 7195-12-0
www.milwaukee-tool.eu

Techtronic Industries (UK) Ltd
Fieldhouse Lane
Marlow Bucks SL7 1HZ
UK



(06.21)
4931 4148 69